

## **User Maintenance Manual**

---

### **RUGGED DRY BLOCK CALIBRATOR MODEL 787 BASIC & SITE**

## Guarantee

©Isothermal Technology Limited

This instrument has been manufactured to exacting standards and is guaranteed for twelve months against electrical break-down or mechanical failure caused through defective material or workmanship, provided the failure is not the result of misuse.

In the event of failure covered by this guarantee, the instrument must be returned, carriage paid, to the supplier for examination and will be replaced or repaired at our option.

FRAGILE CERAMIC AND/OR GLASS PARTS ARE NOT COVERED BY THIS GUARANTEE INTERFERENCE WITH OR FAILURE TO PROPERLY MAINTAIN THIS INSTRUMENT MAY INVALIDATE THIS GUARANTEE

The company is always willing to give technical advice and assistance where appropriate. Equally, because of the programme of continual development and improvement we reserve the right to amend or alter characteristics and design without prior notice. This publication is for information only.

This handbook contains information that has been reproduced with the kind permission of Eurotherm. Such data is subject to the following notice.

©2014 Eurotherm Limited

Eurotherm, the Eurotherm logo, Chessell, nanodac, and Itools, are trademarks of Invensys plc, its subsidiaries and affiliates.





All rights are strictly reserved. No part of this document may be reproduced, modified or transmitted in any form by any means, neither may it be stored in a retrieval system other than for the purpose to act as an aid in operating the equipment to which the document relates, without the prior written permission of Invensys Eurotherm Limited.

Eurotherm Limited pursues a policy of continuous development and product improvement. The specifications in this document may therefore be changed without notice. The information in this document is given in good faith, but is intended for guidance only.



Isothermal Technology Limited  
Pine Grove, Southport, Merseyside, PR9 9AG, England  
Telephone: +44 (0)1704 543830 / Email: [info@isotech.co.uk](mailto:info@isotech.co.uk) / Website: [www.isotech.co.uk](http://www.isotech.co.uk)

# Contents

- 1 UNPACKING AND INITIAL INSPECTION .....5**
- 2 BEFORE YOU USE THE EQUIPMENT .....6**
- 3 SUMMARY OF SYMBOLS .....7**
- 4 ELECTRICITY SUPPLY .....8**
- 5  THE UNIT MUST BE EARTHED .....9**
- 6  EMC INFORMATION .....10**
- 7  CAUTIONARY NOTE .....11**
- 8  SAFETY WARNINGS .....12**
  - 8.1 ENVIRONMENTAL CONDITIONS ..... 12
  - 8.2 DO NOT MODIFY OR DISASSEMBLE..... 12
  - 8.3 BEWARE OF ELECTRICAL CONSIDERATIONS ..... 12
  - 8.4 BE CAREFUL WHERE IT IS USED..... 12
  - 8.5 BE CAREFUL WITH EXTREMES OF TEMPERATURE ..... 12
  - 8.6 BE CAREFUL WITH INSERTS ..... 12
- 9 CONSIDER THE ENVIRONMENT.....13**
- 10 INTRODUCTION .....14**
  - 10.1 COMPARISON CALIBRATION ..... 14
  - 10.2 BASIC OPERATION ..... 14
  - 10.3 SITE OR SELF-CONTAINED CALIBRATORS ..... 14
  - 10.4 EXTERNAL STANDARDS + BASIC ..... 15
  - 10.5 ADVANCED CALIBRATORS..... 15
- 11 MODE OF OPERATION.....16**
  - 11.1 METAL BLOCK BATH ..... 16
  - 11.2 FAST COOL DOWN PROBE (OPTION) ..... 16
- 12 HOW TO MEASURE THE TRUE TEMPERATURE INSIDE THE ACCESSORIES SUPPLIED WITH THE RUGGED DRY BLOCK CALIBRATOR .....17**
  - 12.1 THE CONTROLLER..... 17
  - 12.2 THE REFERENCE THERMOMETER ..... 17
  - 12.3 THE INDUSTRIAL THERMOMETER ..... 17
  - 12.4 RUGGED DRY BLOCK CALIBRATOR 787 BASIC (B)..... 17
  - 12.5 RUGGED DRY BLOCK CALIBRATOR 787 SITE (S)..... 17
  - 12.6 ISOTECH BASIC DRY BLOCK INTERFACE..... 18
  - 12.7 ISOTECH SITE DRY BLOCK INTERFACE ..... 19
- 13 RUGGED DRY BLOCK CALIBRATOR 787 BASIC/SITE - INITIAL TESTING .....20**
- 14 RUGGED DRY BLOCK CALIBRATOR 787 SITE - USING THE INDICATOR TO MEASURE TEMPERATURES REMOTE FROM THE FURNACE .....21**
- 15 RUGGED DRY BLOCK CALIBRATOR 787 SITE - CALIBRATION USING THE INTERNAL INDICATOR TO READ A STANDARD AND UNKNOWN THERMOMETERS .....22**
- 16 RUGGED DRY BLOCK CALIBRATOR 787 SITE - CALIBRATION USING A STANDARD THERMOMETER AND THE INTERNAL INDICATOR.....23**
- 17 RUGGED DRY BLOCK CALIBRATOR 787 BASIC/SITE - CALIBRATION USING A STANDARD THERMOMETER WITH EXTERNAL INDICATION .....24**

- 18 RUGGED DRY BLOCK CALIBRATOR 787 BASIC/SITE - CHECKING USING THE TEMPERATURE INDICATED ON THE CONTROLLER .....25**
- 19 RUGGED DRY BLOCK CALIBRATOR 787 BASIC/SITE - MAINTENANCE .....26**
  - 19.1 THE BASIC WORKINGS ..... 26
  - 19.2 OPERATING PROCEDURES ..... 26
    - 19.2.1 Rugged dry block calibrator 787 Uncertainty ..... 27
    - 19.2.2 Rugged dry block calibrator 787 Heat Up/Cool Down ..... 27
- 20 OPERATING THE MODEL .....28**
  - 20.1 FRONT PANEL LAYOUT ..... 28
    - 20.1.1 The Temperature Controller ..... 28
    - 20.1.2 Altering the Setpoint ..... 28
  - 20.2 CONTROLLER FEATURES ..... 28
    - 20.2.1 Setpoint Ramp Rate ..... 28
    - 20.2.2 Instrument Address ..... 29
  - 20.3 MONITORING THE CONTROLLER STATUS ..... 29
  - 20.4 THE TEMPERATURE INDICATOR: SITE MODELS ONLY ..... 30
  - 20.5 CONNECTING TEMPERATURE SENSORS ..... 30
    - 20.5.1 Platinum Resistance Thermometers, PRTs ..... 30
    - 20.5.2 Input Connections ..... 30
    - 20.5.3 Connecting Thermocouples ..... 30
    - 20.5.4 Setting the Input Type ..... 30
  - 20.6 ENABLING/DISABLING CUSTOM CALIBRATION ..... 31
  - 20.7 INSTRUMENT ADDRESS ..... 31
  - 20.8 MONITORING THE INDICATOR STATUS ..... 32
    - 20.8.1 Units ..... 32
  - 20.9 INDICATOR OPERATION ..... 32
- 21 CALIBRATION DATA EXAMPLE .....33**
  - 21.1 CONNECTING A 4-20MA CURRENT TRANSMITTER ..... 33
  - 21.2 USING THE CURRENT LOOP INTERFACE 935-06-161 WITH THE SITE MODEL ..... 35
  - 21.3 TESTING THERMAL SWITCHES ..... 36
  - 21.4 PROCEDURE FOR THE REVERSAL OF THE POLARITY FOR THE SWITCH CONTACT FEATURE ..... 36
  - 21.5 SELECTING INPUT TYPE ..... 36
- 22 USING THE PC INTERFACE .....37**
  - 22.1 CONNECTIONS ..... 37
  - 22.2 PROTOCOL ..... 37
- 23 CAL NOTEPAD .....38**
  - 23.1 DEVELOPMENT ..... 38
  - 23.2 ISOTECH I-CAL EASY LOG ..... 39
- 24 DIAGNOSTIC ALARMS .....40**
- 25 APPENDIX 1: TROUBLE SHOOTING .....41**
  - 25.1.1 Unit fails to operate ..... 41
  - 25.1.2 Will not control at 35°C ..... 41
  - 25.1.3 Indicator reads incorrectly ..... 41
  - 25.1.4 Unit unstable ..... 41
  - 25.1.5 Cannot establish PC Communications ..... 41
- 26 APPENDIX 3: INDICATOR CONFIGURATION (REFERENCE ONLY) .....42**



## **1 Unpacking And Initial Inspection**






 

Our Packing Department uses custom designed packaging to send out your unit, but as accidents can still happen in transit, you are advised, after unpacking the unit, to inspect it for any sign of shipping damage and confirm that your delivery is in accordance with the packing check list. If you find any damage or that part of the delivery is missing notify us or our agent and the carrier immediately. If the unit is damaged you should keep the packing for possible insurance assessment.

## **2 Before You Use The Equipment**

Please read the handbook and familiarise yourself with all warnings, hazards and safety information. Regularly inspect the equipment, accessories and electrical leads. Do not use if there is any sign of damage. Keep the equipment clean, only use a damp cloth. Do not use solvents or allows liquids to enter the case.



### 3 Summary of Symbols

	ISO3864 – Caution, read the entire manual before use
	IEC 417 – Caution, hot surface (risk of burn)
<b>o</b>	Off
<b>I</b>	On
	Waste Electrical and Electronic Equipment (WEEE directive) symbol
	Complies with European regulations (CE mark)
	USB symbol
	Ethernet RJ45 symbol
	Risk of Electrical Shock
<b>I O I O I</b>	RS422 Serial Port

## 4 Electricity Supply

Before connecting to the electricity supply please familiarise yourself with the parts of the manual relevant to your model.

Your unit's supply voltage requirement is specified on a label on the instrument along with the serial number. Only connect to a power supply matching the requirement stated on the equipment.





## 5 The Unit Must Be Earthed

This equipment is a Class 1 Appliance and must be earthed (grounded). Use the supplied power cord and plug it directly into an AC outlet with a protective earth.

If using an alternative cord ensure it is of adequate rating.

If fitting a plug to the cable we have supplied the cable is colour coded as follows:

<b>Colour</b>	<b>Function</b>
Green/yellow	Earth (Ground)
Brown	Live (line)
Blue	Neutral

Do not use the equipment if it is not correctly earthed. If in doubt consult Isothermal Technology Ltd or a qualified electrician.

## 6 EMC Information

This product meets the requirements of the European Directive on Electromagnetic Compatibility (EMC) 89/336/EEC as amended by EC Directive 92/31/EEC and the European Low Voltage Directive 73/25/EEC, amended by 93/68/EEC. To ensure emission compliance please ensure that connecting leads are fully screened.

The product meets the susceptibility requirements of EN 50082-1, criterion B.

## 7 **Cautionary Note**

Operators of this equipment should be adequately trained in the handling of hot and cold items. It is important the user has been trained about the selection and use of liquids over a wide temperature range. It is expected that personnel using this equipment will be competent with the management of apparatus which may be powered or under extremes of temperature and are able to appreciate the hazards which may be associated with and the precautions to be taken with, such equipment.

## 8 Safety Warnings

### 8.1 Environmental Conditions

- Operating temperature: 5-40°C (41-122°F)
- Relative Humidity: 5-80% - Non-condensing

### 8.2 Do Not Modify Or Disassemble

- Do not use the apparatus for jobs other than those for which it was designed, i.e. the calibration of thermometers
- There are no user serviceable parts inside. Do not dismantle or modify the apparatus. For repair information contact Isothermal Technology Ltd
- For equipment with fans, the fan should be kept free from dust build up; a soft brush or vacuum cleaner may be used on the external grill

### 8.3 Beware Of Electrical Considerations

- The equipment is for installation category II (transient voltages) and pollution degree II in accordance with IEC 664 at altitudes to 2000 metres
- Sensor Input Connection must never exceed 30V with reference to ground
- Thermostat test inputs should be voltage free: isolate from any voltage source during test

### 8.4 Be Careful Where It Is Used

- The equipment is not for use in hazardous areas or in an environment close to flammable materials or gases
- The equipment must be used on a flat level surface, with adequate space around it for air flow and avoid blocking ventilation slots
- Ensure free space above the unit to avoid risk of burn or fire
- The equipment should only be used indoors
- Site in a way that allows access to the power switch, and to allow the cable to be disconnected
- Avoid excessive heat, humidity, dust and vibration ensuring it will not be subjected to dripping or splashing liquids

### 8.5 Be Careful With Extremes Of Temperature

- In normal use the calibration volume, inserts and probes will become very hot and present a burn hazard
- Do not remove inserts, probes or handle the equipment when it is hot or cold.
- Allow the equipment and accessories to reach a temperature between ambient and 70°C before switching off or storing the equipment in its case
- Do not use the equipment outside its recommended temperature range
- Operating the equipment at extremes of temperature for extended periods may call for early replacement of the heating assembly
- Wear appropriate protective clothing

### 8.6 Be Careful With Inserts

- Only use inserts supplied with, or ordered specifically for, this model
- Do not handle inserts while they are very hot or cold
- Inserts for low temperature models may melt and cause a fire if used in high temperature models
- Only use Isotech inserts which are specially treated to avoid them from becoming stuck in the calibration volume
- Do not use powders, liquids or compounds in the insert; this may lead to the insert or probes becoming stuck

## 9 Consider The Environment



The equipment should be recycled or disposed of in a proper way; following the Waste Electrical and Electronic Equipment (WEEE) directive

## 10 Introduction

The purpose of the Rugged dry block calibrator models is to provide an adjustable isothermal enclosure for calibration purposes. It has been designed to be rugged and easily maintained.

The isothermal enclosure consists of a fixed heater block into which an insert can be placed. Temperature sensors for calibration are placed in suitably drilled holes in the insert. The replaceable inserts enable a variety of items to be calibrated.

Additionally there are accessories to allow the calibration of surface sensors and also infrared thermometers.

The heater block houses a heater and the control sensor used by the temperature controller to sense the block temperature.

There are two electrically driven fans in the unit. One runs continuously and cools the electronics in the instrument and the other is switched to cool the block when the set temperature is lower than the block temperature.

### 10.1 Comparison Calibration

By definition, one compares industrial thermometers to a calibrated standard. There are three methods commonly used.


### 10.2 Basic Operation

Using the controller as the "calibrated standard". This method means that the complete bath is calibrated by comparing the controller reading to a calibrated standard placed in the bath.

This is a common method but is unsafe since the control sensor is


- a) inaccessible
- b) in the wrong place to give correct temperature of the insert

For these reasons it fails to satisfy ISO9000 and gives large uncertainties.

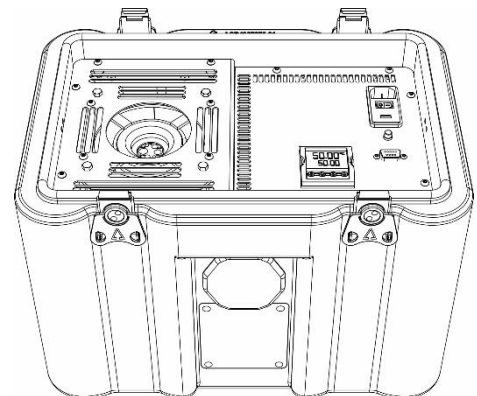

### 10.3 Site or Self-Contained Calibrators


In these an indicator and external calibrated sensor are used to measure the temperature of the insert. This arrangement gives good results and traceability. To recalibrate however it does mean sending the whole calibrator back to the calibration laboratory. The calibrator is self-contained, self-sufficient and meets ISO9000 requirements.

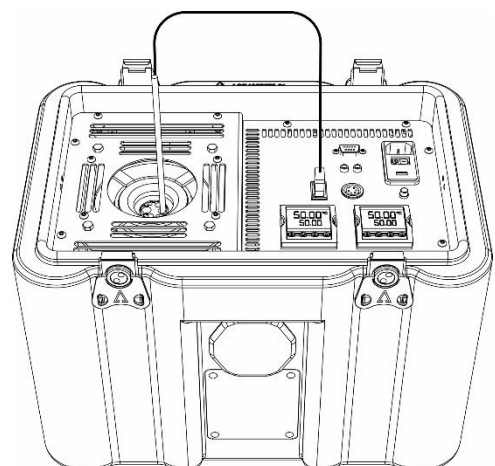

### 10.4 External Standards + Basic


Here a separate indicator and calibrated sensor are used to measure the inserts temperature. With a suitable indicator such as the Isotech milliK this gives the most accurate and reliable results, depending on the indicator.

It means that the calibrator does not need calibrating; only the indicator and its calibrated sensor need re-calibration. One indicator may be used with a range of blocks. This method also meets ISO9000 requirements.

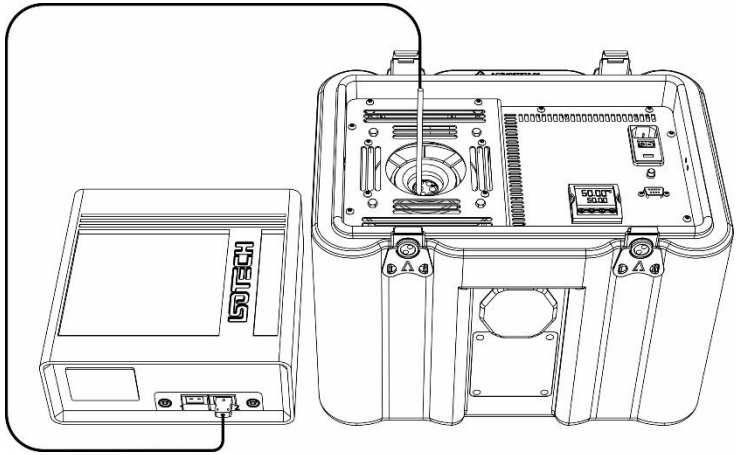

### 10.5 ADVANCED Calibrators

The ADVANCED model includes an indicator with channels for both the test thermometers and an external calibrated sensor used to measure the temperature of the insert. This allows best practice calibration with established traceability and uncertainty. To recalibrate however, it does mean sending the whole calibrator back to the calibration laboratory. The calibrator is self-contained for reference and test probes, self-sufficient and meets ISO9000 requirements.

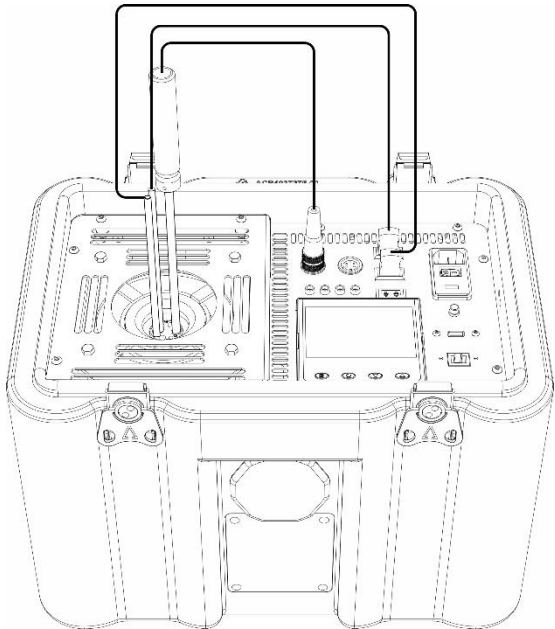


## 11 Mode Of Operation

### 11.1 Metal Block Bath

The thermometers under test are placed into suitable holes in the metal insert. For the ADVANCED and Site models a calibrated reference probe should be placed into the insert and the actual temperature can be read from the temperature indicator. For the Basic models an external temperature indicator should be used.

For traceable calibration the actual value of the insert temperature should be recorded along with the values from the sensors under test.

Wait until the temperature indicated by the controller and the output of the thermometer are both stable (see specification for typical values) record three sets of readings over a period of about six minutes. Check that these readings are consistent and then calculate their average values. If the device has itself been calibrated, correct the average values accordingly.

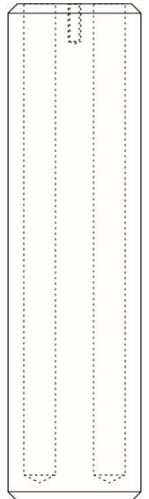

### 11.2 Fast Cool Down Probe (Option)

The fast cool down probe can be attached to a suitable air supply and then placed into the Rugged dry block calibrator insert for rapid cooling.



**Take care when placing the probe into the hot block.**

Ensure the air supply is set to give an appropriate flow rate. Guard against setting so high that the probe may be blown from the insert.



## 12 How To Measure The True Temperature Inside The Accessories Supplied With The Rugged dry block calibrator

The controller of the Rugged dry block calibrator controls and reads the temperature of the block  
Remember the following:-

### 12.1 The Controller

The controller is used to set a constant temperature and create an isothermal environment for the comparison calibration of temperature sensors.

### 12.2 The Reference Thermometer

The reference thermometer is placed in the accessory or insert and measures the true temperature inside the insert or accessory.

### 12.3 The Industrial Thermometer

The industrial thermometer is placed in the accessory or insert and is compared to the true temperature as indicated by the reference thermometer. An insert will typically have a 1% immersion error. For more details see - Depths of Immersion. Tavener J. P – available at [www.isotech.co.uk](http://www.isotech.co.uk)

The Rugged dry block calibrator 787 series consists of two models, the Basic (B) and Site (S). Both models have been designed to be rugged and easily maintained.

By using a proprietary plug-in controller the total electronics package can be replaced in a few minutes. As can be seen from the parts list, remarkably few components have been used, each of which are easily removed and replaced. All models have a temperature range of 35 to 660°C.

### 12.4 Rugged dry block calibrator 787 Basic (B)

This model provides an isothermal enclosure (metal block) in which thermometers and thermostats can be checked against the temperature indicated on the temperature controller.

For traceable calibration a standard (reference) probe should be placed into the metal blocks alongside the units under test.

The probe under test should be calibrated by comparison to the standard probe.

### 12.5 Rugged dry block calibrator 787 Site (S)

The S is again similar to the B but this unit has the addition of a digital temperature indicator. The indicator is independent from the controller and can be programmed to work with a thermocouple or industrial Pt 100 resistance thermometer.

This combination of sensor and probe can be calibrated. Then the units under test can be compared to the independent calibrated measuring systems allowing for traceable calibration.

The Rugged dry block calibrator 787 Series represents the third generation of a ten year development program. During which many customer improvement suggestions have been incorporated into the models. Such suggestions have generally arisen from technical queries posed by equipment users, therefore please consult with us if at all unsure with any aspect of our equipment.

The Rugged dry block calibrator 787 models are part of a range of portable calibrators designed and made by ourselves. Please contact us if you require more information about our other products.

## 12.6 Isotech Basic Dry block interface

### 1. Main supply voltage connection socket

This socket allow the Mains Voltage to be applied to power up the equipment. Use only the supplied lead or a suitably specified IEC alternative. Confirm the supply voltage using the ratings label on the rear of the equipment.

### 2. Power On/Off switch

Once the Power lead is connected, this switch will power up and down the equipment

### 3. Fuse carrier and window showing fuse rating

With the mains cable disconnected, the fuse carrier can be removed for the inspection or replacement of the fuse. The fuse rating is displayed through the window.

### 4. Temperature Controller


Refer to Section 21 for details.

### 5. Dry Block Volume

This is the actual heat source of the Basic unit.

### 6. PC Serial interface

Enables connection to a PC. Refer to Section 23 for details.

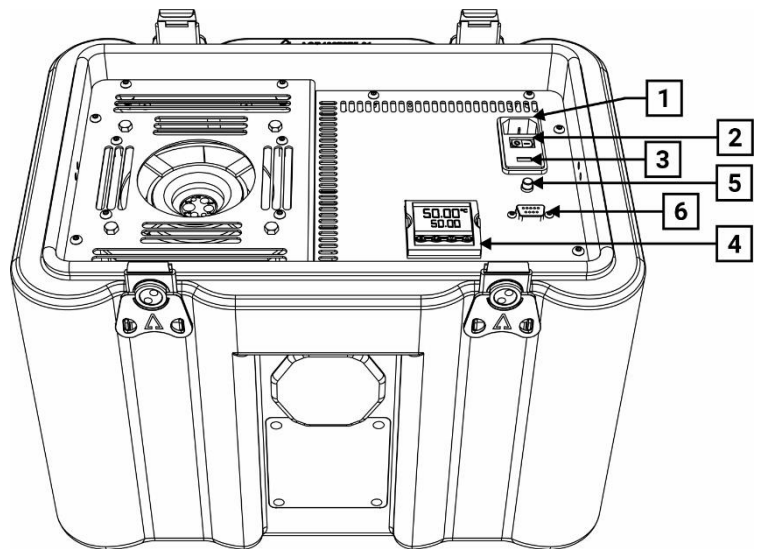

## 12.7 Isotech Site Dry block interface

### 1. Main supply voltage connection socket

This socket allow the Mains Voltage to be applied to power up the equipment. Use only the supplied lead or a suitably specified IEC alternative. Confirm the supply voltage using the ratings label on the rear of the equipment.

### 2. Power On/Off switch

Once the Power lead is connected, this switch will power up and down the equipment

### 3. Fuse carrier and window showing fuse rating

With the mains cable disconnected, the fuse carrier can be removed for the inspection or replacement of the fuse. The fuse rating is displayed through the window.

### 4. PRT input socket

These allow for the connection of external Platinum resistance thermometers. **Warning:** Do not connect any other form of input to these sockets.

### 5. Thermocouple input socket

These allow for the connection of a range of Thermocouples to be connected. **Warning:** Do not connect any other form of input to these sockets.

### 6. Temperature controller

Refer to Section 21 for details.

### 7. Dry Block Volume


This is the actual heat source of the Site unit.

### 8. Temperature indicator

### 9. PC Serial interface

Enables connection to a PC. Refer to Section 23 for details.

### 10. Switch Contact (thermostat)

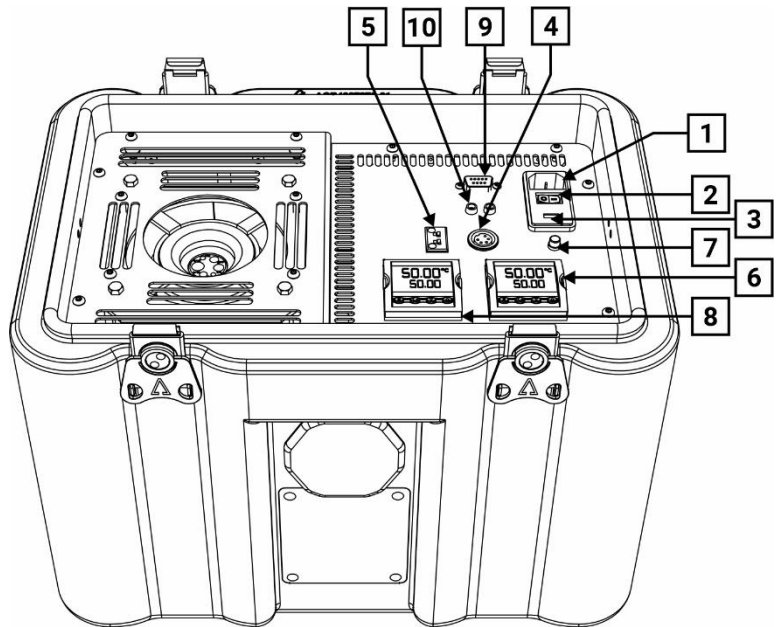

## 13 Rugged dry block calibrator 787 Basic/Site - Initial Testing

This unit was fully tested before despatch to you but please check its operation as outlined below.

After connecting the Rugged dry block calibrator 787 to the electricity supply, the temperature controller display will show the temperature of the block and the last set-point value. The S controller and indicator both go through a self-test sequence first. The fan on the front panel should be heard running.

Change the set-point to 100°C and observe that the block temperature rises and settles to this value. For the S; place a thermometer in an insert in the block and connect it to the suitably configured indicator. Confirm that the indicator agrees within  $\pm 2^{\circ}\text{C}$  of the controller.

Change the set-point to 70°C; this should cause the second cooling fan to operate until the temperature falls to below 75°C when it will turn off.

Your unit should have performed as described above and can now be used for calibration.

If any problems or faults arise during these tests please contact us or our agents for help and advice.

### **IMPORTANT NOTICE**

The controller's function settings are preset and will not require adjustment.

## **14 Rugged dry block calibrator 787 Site - Using The Indicator To Measure Temperatures Remote From The Furnace**

1. Remove the Rugged dry block calibrator 787 from its case and visually inspect it for any damage it may have sustained since it was last used. Insert the required metal insert into the furnace block.
2. Connect the Rugged dry block calibrator 787 to a suitable power supply and set the controller to either 0°C if the furnace is not to be used or to the required temperature if it is going to be used to calibrate thermometers.
3. If the standard thermometer is going to be used to measure a temperature other than the metal block, reconfigure and set the offset of the indicator accordingly. Connect the standard thermometer to the indicator which will now display its temperature.
4. If the indicator is going to be used to measure the temperature of a remote thermometer, reconfigure and set the user calibration of the indicator to correspond to that type of thermometer, connect the thermometer to the indicator and the corresponding temperature will be displayed.
5. If the Rugged dry block calibrator 787 has itself been calibrated, correct the average values accordingly. If there is no calibration use an uncertainty figure of  $\pm 1\%$  for the temperature indicated by the standard thermometer and indicator.
6. Reset the controller and/or repeat the calibration for another thermometer.
7. When the calibration is complete, reset the controller to 0°C and wait until the unit has cooled to below 400°C before moving the Rugged dry block calibrator 787 to a new location. The Rugged dry block calibrator 787 must be cooled to below 100°C before it can be put back into its carrying case.

## **15 Rugged dry block calibrator 787 Site - Calibration Using The Internal Indicator To Read A Standard And Unknown Thermometers**

1. Remove the Rugged dry block calibrator 787 from its case and visually inspect it for any damage it may have sustained since it was last used. Insert the required metal insert into the furnace block using the tool supplied to avoid damage to the heater assembly.
2. Connect the Rugged dry block calibrator 787 to a suitable power supply and set the controller to the required temperature.
3. Place the thermometer(s) for calibration and the standard thermometer into suitable holes in the metal insert; wait for the temperature to stabilise.
4. When the temperature indicated by the controller and the standard are stable (see specification for typical values) record the reading of the standard. Connect the thermometer under test, in place of the standard, to the indicator and re-configure the indicator for the new sensor type as necessary if user calibration is enable for the standard it will need to be turned off or modified for the unit under test. Record the temperature of the thermometer under test. For security reconnect the standard thermometer, reconfigure the indicator and make sure the temperature has not changed from the first reading.
5. If the Rugged dry block calibrator 787 has itself been calibrated, correct the average values accordingly. If there is no calibration, use an uncertainty figure of  $\pm 1\%$  for the temperature indicated by the standard thermometer and indicator.
6. Reset the controller and/or repeat the calibration for another thermometer.
7. When the calibration is complete, reset the controller to  $0^{\circ}\text{C}$  and wait until the unit has cooled to below  $400^{\circ}\text{C}$  before moving the Rugged dry block calibrator 787 to a new location. The Rugged dry block calibrator 787 must be cooled to below  $100^{\circ}\text{C}$  before it can be put back into its carrying case.

## **16 Rugged dry block calibrator 787 Site - Calibration Using A Standard Thermometer And The Internal Indicator**

1. Remove the Rugged dry block calibrator 787 from its case and visually inspect it for any damage it may have sustained since it was last used. Insert the required metal insert into the furnace block using the tool supplied to avoid damage to the heater assembly.
2. Connect the Rugged dry block calibrator 787 to a suitable power supply and set the controller to the required temperature.
3. Place the thermometer(s) for calibration into a suitable insert(s) in the metal block and wait for the temperature to stabilise, connect the standard thermometer to the indicator.

Ensure the indicator is configured for the correct sensor and where applicable the calibration data has been entered and user calibration enable.

4. When the temperature indicated by the controller and that of the other thermometers are stable (see specification for typical values) record three sets of readings over a period of about six minutes. Check that these readings are consistent and use their average values for the final calibration figures.
5. If the Rugged dry block calibrator 787 has been calibrated, correct the figures accordingly.
6. Reset the controller and/or repeat the calibration for another thermometer.
7. When the calibration is complete, reset the controller to 0°C and wait until the unit has cooled to below 400°C before moving the Rugged dry block calibrator 787 to a new location. The Rugged dry block calibrator 787 must be cooled to below 100°C before it can be put back into its carrying case.

## 17 Rugged dry block calibrator 787 Basic/Site - Calibration Using A Standard Thermometer With External Indication

1. Remove the Rugged dry block calibrator 787 from its case and visually inspect it for any damage it may have sustained since it was last used. Insert the required metal insert into the furnace block using the tool supplied to avoid damage to the heater assembly.
2. Connect the Rugged dry block calibrator 787 to a suitable power supply and set the controller to the required temperature.
3. Place the thermometer(s) for calibration and the standard thermometer into suitable holes in the metal insert; wait for the temperature to stabilise.
4. When the temperature indicated by the controller and that of the other thermometers are stable (see specification for typical values) record three sets of readings over a period of about six minutes. Check that these readings are consistent and use their average values for the final calibration figures.

Compare the units under test to the standard thermometer.

5. Reset the controller and/or repeat the calibration for another thermometer.
6. When the calibration is complete, reset the controller to 0°C and wait until the unit has cooled to below 400°C before moving the Rugged dry block calibrator 787 to a new location. The Rugged dry block calibrator 787 must be cooled below 100°C before it can be put back into its carrying case.



## **18 Rugged dry block calibrator 787 Basic/Site - Checking Using The Temperature Indicated On The Controller**

1. Remove the Rugged dry block calibrator 787 from its case and visually inspect it for any damage it may have sustained since it was last used. Insert the required metal insert into the furnace block using the tool supplied to avoid damage to the heater assembly.
2. Connect the Rugged dry block calibrator 787 to a suitable power supply and set the controller to the required temperature.
3. Place the thermometer for calibration into a suitable hole in the metal insert and wait for the temperature to stabilise.
4. When the temperature indicated by the controller and the output of the thermometer are both stable (see specification for typical values) record three sets of readings over a period of about six minutes. Check that these readings are consistent and then calculate their average values.
5. If the Rugged dry block calibrator 787 has itself been calibrated, correct the average values accordingly.
7. Reset the controller and/or repeat the calibration for another thermometer.
8. When the calibration is complete, reset the controller to 0°C and wait until the unit has cooled to below 400°C before moving the Rugged dry block calibrator 787 to a new location. The Rugged dry block calibrator 787 must be cooled below 100°C before it can be put back into its carrying case.

## **19 Rugged dry block calibrator 787 Basic/Site - Maintenance**

Turn the electricity supply off before attempting any cleaning operation.

The only moving parts are the fans. They have sealed-for-life bearings. Depending on the environment in which it is used, periodic cleaning is recommended. Cleaning may be accomplished by the use of a small dry paint brush.

The instrument should be periodically checked to ensure it is in good order both mechanically and electrically.

### **19.1 The Basic Workings**

The purpose of the Rugged dry block calibrator 787 models is to provide an adjustable isothermal enclosure for calibration purposes.

The isothermal enclosure consists of a fixed heater block into which an insert can be placed. Items for calibration are placed in suitably drilled holes in the insert. The replaceable inserts enable a variety of items to be calibrated.

The heater block houses a heater and the control sensor used by the temperature controller to sense the block temperature. To obtain and maintain a required temperature the controller varies the power to the heaters via a solid state relay.

There are two electrically driven fans in the unit. One runs continuously and cools the electronics in the instrument and the other fan cools the heater block when called upon to do so by the temperature controller. This second fan is operated by the controller to cool the heater block when the set point is 5°C or more lower than the block temperature, when this second fan is on cooling to temperature appears on the controller to signify this.

### **19.2 Operating Procedures**


The following operating procedures have been written for one of the two models as indicated by the Procedures heading. However the procedure may be common to the other models and in such cases the relevant models are indicated in brackets.

Please note: No oils, greases or powders should be introduced into the Rugged dry block calibrator 787 or its inserts.

Only use Isotech supplied inserts.


The inserts are specially plated for use in the block. Using non-Isotech inserts may lead to failure of the block and cause the insert to seize in the block.

### 19.2.1 Rugged dry block calibrator 787 Uncertainty

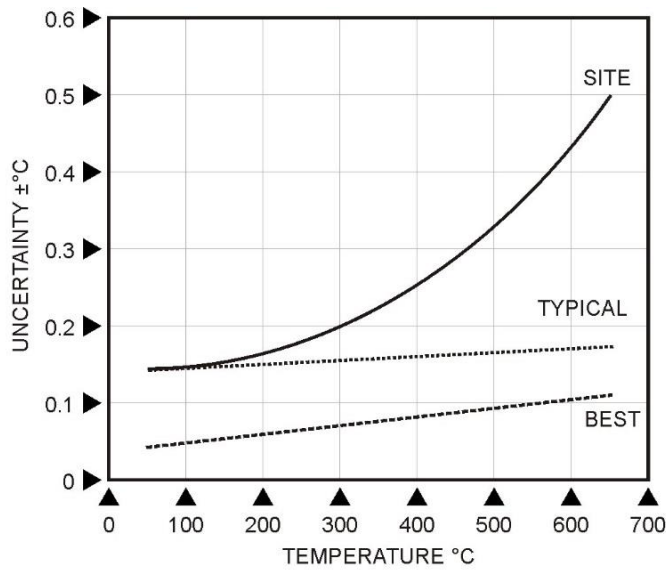

BEST UNCERTAINTY - USING JUPITER BASIC WITH A TT12 AND A 935-14-72 CALIBRATION SYSTEM  
 TYPICAL UNCERTAINTY - USING JUPITER BASIC WITH A TTI AND A 935-14-72  
 SITE VERSION UNCERTAINTY - JUPITER SITE USING BUILT IN INDICATOR AT THE TIME OF CALIBRATION

### 19.2.2 Rugged dry block calibrator 787 Heat Up/Cool Down

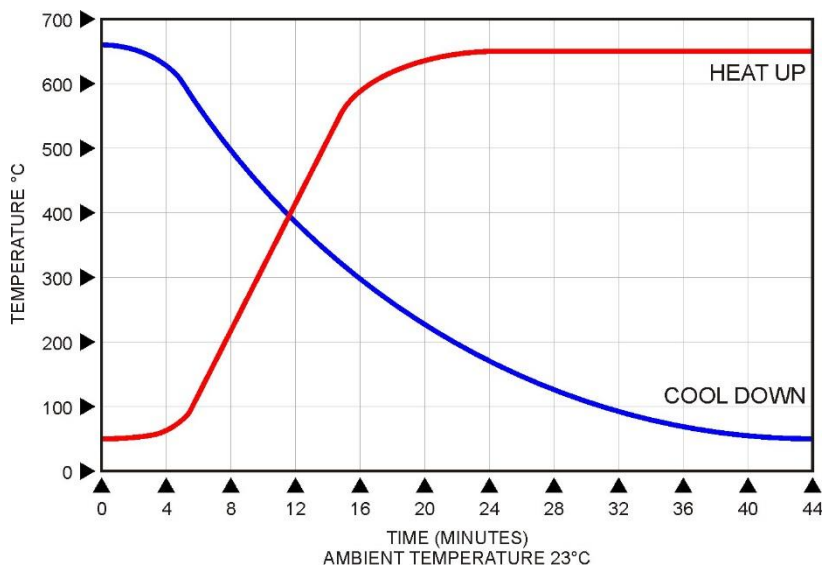


A full evaluation of the Rugged dry block calibrator 787 is available, please contact the factory for availability



## 20 Operating The Model

### 20.1 Front Panel Layout

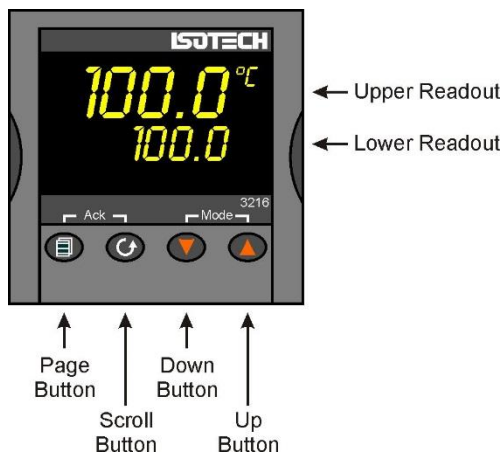

#### 20.1.1 The Temperature Controller

The controller has a dual display, the upper display indicates the nominal block temperature, and the lower display indicates the desired temperature or setpoint.

#### 20.1.2 Altering the Setpoint

To change the setpoint of the controller simply use the UP and DOWN keys to raise and lower the setpoint to the required value. The lower display changes to indicate the new setpoint.

## 20.2 Controller Features

### 20.2.1 Setpoint Ramp Rate

By default the Dry Blocks are configured to heat and cool as quickly as possible. There may be some calibration applications where it is advantageous to limit the heating or cooling rate.

An example might be when testing bimetallic thermostats; by forcing the Dry Block to heat at a controlled rate it is easier to determine the temperature at which the thermostat changes state.

The Dry Block can have its heating rate limited with the Setpoint Ramp Rate feature. This feature is accessed from the Scroll key. Depress the key until the display shows,

SP.RAT

The upper display will show the current value, and is adjustable from OFF to 999.9. The units are °C/min and are adjustable via the UP/DOWN keys.

When the SP.RAT is active the lower setpoint display will now automatically update with the current value, known as the working setpoint. The setpoint can be seen by pressing either the UP and DOWN key.

The Setpoint ramp rate operates when the bath is heating and cooling.

### 20.2.2 Instrument Address

The controller has a configurable "address" which is used for PC communications. Each instrument has an address; this allows several instruments to be connected in parallel on the same communications bus. The default value is 1. This address would only need to be changed if more than one Dry Block is connected to the same PC port.

To check the Address value press the scroll key until the lower display indicates,

ADDR

The upper display will show the current value that can be modified with the UP and DOWN keys.

### 20.3 Monitoring The Controller Status

A row of beacons indicate the controllers status as follows,

OP1	Heat Output
OP2	Cool Output (only for models which operate below 0°C)
REM	This beacon indicates activity on the PC interface

For models fitted with cool down fans, such as the Calisto and Rugged dry block calibrator, the lower display will alternate between the setpoint and the message, cooling to temperature. This message is not an error but is showing that the cooling fan is operating. It will automatically switch off when the temperature is within 5°C of the setpoint.

### Units

Momentary pressing of the Scroll key will show the controller units °C or °F.



## 20.4 The Temperature Indicator: Site Models Only

The Site models include an electronic temperature indicator. The indicator can be configured for the desired sensor type, and for custom calibration data. The customer calibration data can be set ON or OFF.

## 20.5 Connecting Temperature Sensors

### 20.5.1 Platinum Resistance Thermometers, PRTs


Set the input type to suit from either the front panel of the Isotech Config Software utility.

PRTs can be connected to Inputs P1 and P2. When connecting a PRT ensure the corresponding thermocouple input is not used, that is if connecting a PRT to Input P1 then Input T1 must not be used, is if connecting a PRT to Input P2 then Input T2 must not be used.

### 20.5.2 Input Connections

The five pin cable plug to suit PRTs is part number 935-16-107. These are readily available, suppliers include RS Components (Part Number 129-8573) and Farnell (Part Number 112-2585).

With three wire PRT connections ensure identical lead resistance in all three legs of the connection by using the same length and gauge of cables.

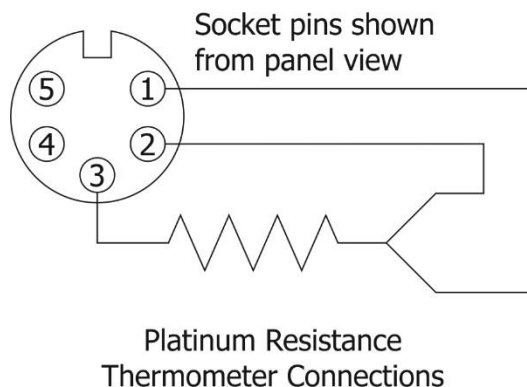

### 20.5.3 Connecting Thermocouples

Set the input type to suit from either the front panel of the Isotech Config Software utility.

Thermocouples can be connected to Inputs T1, T2 and T3. When connecting a thermocouple ensure the corresponding PRT input is not used, that is if connecting a thermocouple to Input T1 then Input P1 must not be used, is if connecting a thermocouple to Input T2 then Input P2 must not be used.

Input connectors are the industry standard "miniature thermocouple plugs".

### 20.5.4 Setting the Input Type

A 100 Ohm resistance thermometer can be connected to the PRT Connector or a thermocouple may be connected to the miniature TC Connector.

***Ensure that only a PRT or a TC is connected at any one time. If a PRT and TC are connected simultaneously the indicator will read in error.***

Check that any sensor placed into the equipment is suitable for the temperature range. Sensors can be damaged if taken outside their normal operating limits.

The desired sensor type is easily set, press the Scroll key until the lower display indicates,



In.Type

The upper display will show the current set sensor type,

J.tc	J thermocouple
K.tc	K thermocouple
L.tc	L thermocouple
r.tc	R thermocouple (Pt/Pt13%Rh)
b.tc	B thermocouple (Pt30%Rh/Pt6%Rh)
n.tc	N thermocouple
t.tc	T thermocouple
S.tc	S thermocouple (Pt/Pt10%Rh)
PL.2	PL 2 thermocouple
rtd	100 Ohm platinum resistance thermometer.
T012	E thermocouple

Again the value can be modified with the UP and DOWN keys.

## 20.6 Enabling/Disabling Custom Calibration

Custom calibration allows the indicator to be programmed to suit a particular temperature sensor. This allows the indicator to automatically show the true temperature, without having to manually apply a correction.

When the Custom or User Calibration is active the indicator will show the REM beacon lit continuously. The use of User calibration can make a significant difference to the accuracy of the instrument, and this REM beacon provides a clear and continuous indication of the calibration status. Isotech will configure and set user calibration when the Dry Block is ordered with a temperature sensor.

To alter the calibration status press the Scroll key until the lower display shows,  
UCAL

The upper display will indicate either,  
ON for user calibration

Or

OFF for factory calibration of the indicator

Use the UP and DOWN keys to toggle between the two values.

When calibrating an unknown sensor against a calibrated probe it may be necessary to switch the calibration off for the unknown, and on for the calibrated probe.

## 20.7 Instrument Address

Like the controller, the indicator has a configurable "address" which is used for PC communications. Each instrument has an address; this allows several instruments to be connected in parallel on the same communications bus. The default value is 2 (The controller defaults to 1). This address would only need to be changed if more than one Dry Block is connected to the same PC port.

To check the Address value press the scroll key until the lower display indicates,  
ADDR

The upper display will show the current value that can be modified with the UP and DOWN keys.

## 20.8 Monitoring The Indicator Status

For the indicator the REM beacon is lit continuously when the user calibration is active, the REM beacon flashes when the PC communications port is active.

### 20.8.1 Units

Momentary pressing of the Scroll key will show the controller units °C or °F.

## 20.9 Indicator Operation

The indicator can be configured with up to five custom calibration points; the points contain "data pairs". First the temperature (point) and secondly the Error (offset) at this temperature point. Isotech Dry Block calibration certificates will show the values to suit a particular sensor.

These values can be inspected, and modified with the following procedure,

Hold the PAGE key down until the display indicates,  
CONF  
GOTO

then

0  
CODE

Set the Code to 2 with the UP key

The display reads,  
CONF

Press the Page Key until the controller shows  
CAL

Now use the Scroll key to examine the data pairs. The values Pnt 1- Pnt 5 and Ofs 1 to Ofs 5 can be modified with the UP and DOWN keys.

To exit this mode hold the Page key until the top display shows,  
CONF  
GOTO

And then set the upper display to Lev 1. While in this mode take care not to modify other parameters.



## 21 Calibration Data Example


A maximum of five points may be entered, shown as Pnt 1 to Pnt 5 for the temperature point and Ofs 1 to Ofs 5 for the offset values.

The Pnt values must be entered in ascending order.

Set a Pnt to a value lower than the previous point to disable it.

The indicator would be programmed with the following data:

Pnt 1	100	Ofs 1	0.8
Pnt 2	300	Ofs 2	1.1
Pnt 3	500	Ofs 3	2.1
Pnt 4	-999	Ofs 4	0
Pnt 5	-999	Ofs 5	0

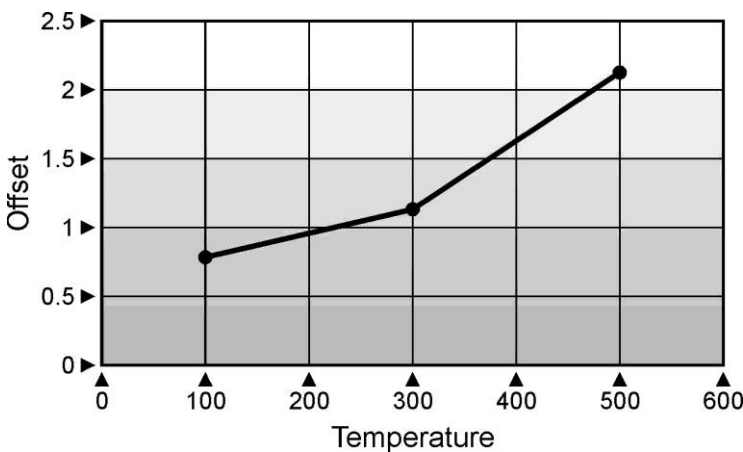

### 21.1 Connecting A 4-20mA Current Transmitter

The transmitter should be powered externally, a 2.49 Ohm current sense resistor is fitted internally to the equipment and this allows the indicator to read mA input.

To scale the linear to display temperature:

- 1 The scaling can be configured in the CAL sub-menu within CONF menu.
- 2 Access the Input sub-menu by pressing the Page button.
- 3 Set the input type to mV.
- 4 Press again to enter the mv.hi value (see table below)
- 5 Press again to enter the mv.lo value (see table below)
- 6 Press again to enter the rng.hi value (see table below)
- 7 Press again to enter the rng.lo value (see table below)
- 8 To exit press Page and Scroll buttons together and select level 1 using the up/down buttons.

**EXAMPLE:** From the input menu iP set the mv.hi, rng.hi and rng.lo parameters to suit see table below:

**Linear Input Scaling - The next 4 parameters only appear if a linear input is chosen**


**e.g. 4 to 20mA = 0 to 100°C**

	mv.lo	Input value low	i.e. 4mA set 9.96
	mv.hi	Input value high	i.e. 20mA set 49.8
	rng.lo	Displayed reading low	0°C
	rng.hi	Displayed reading high	100°C


E.g. 4-20mA = 0 to 100°C

mv.lo	=	9.96 (mV)	(4mA x 2.49Ω)
mv.hi	=	49.8 (mV)	(20mA x 2.49Ω)
rng.lo	=	0 (°C)	
rng.hi	=	100 (°C)	

**CONNECTION DETAILS**

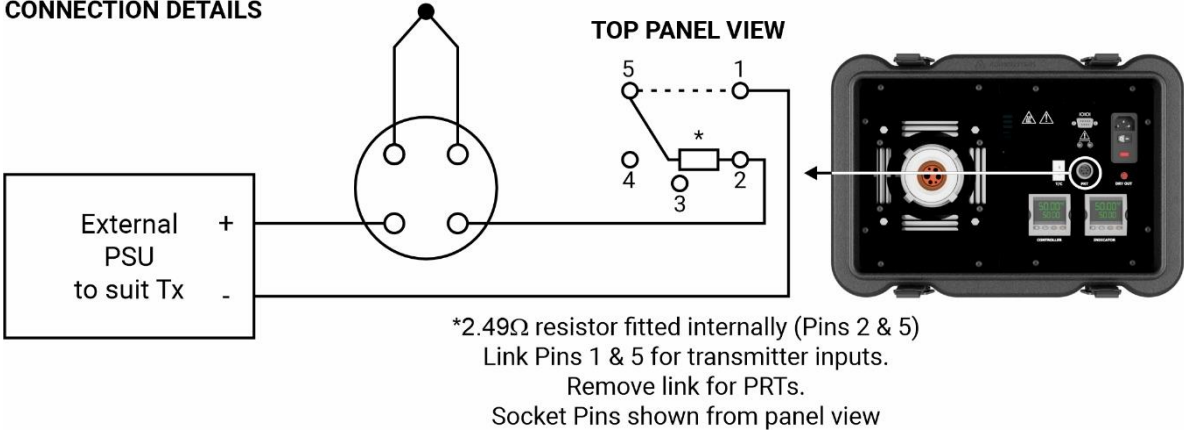

## 21.2 Using the Current Loop Interface 935-06-161 with the Site model

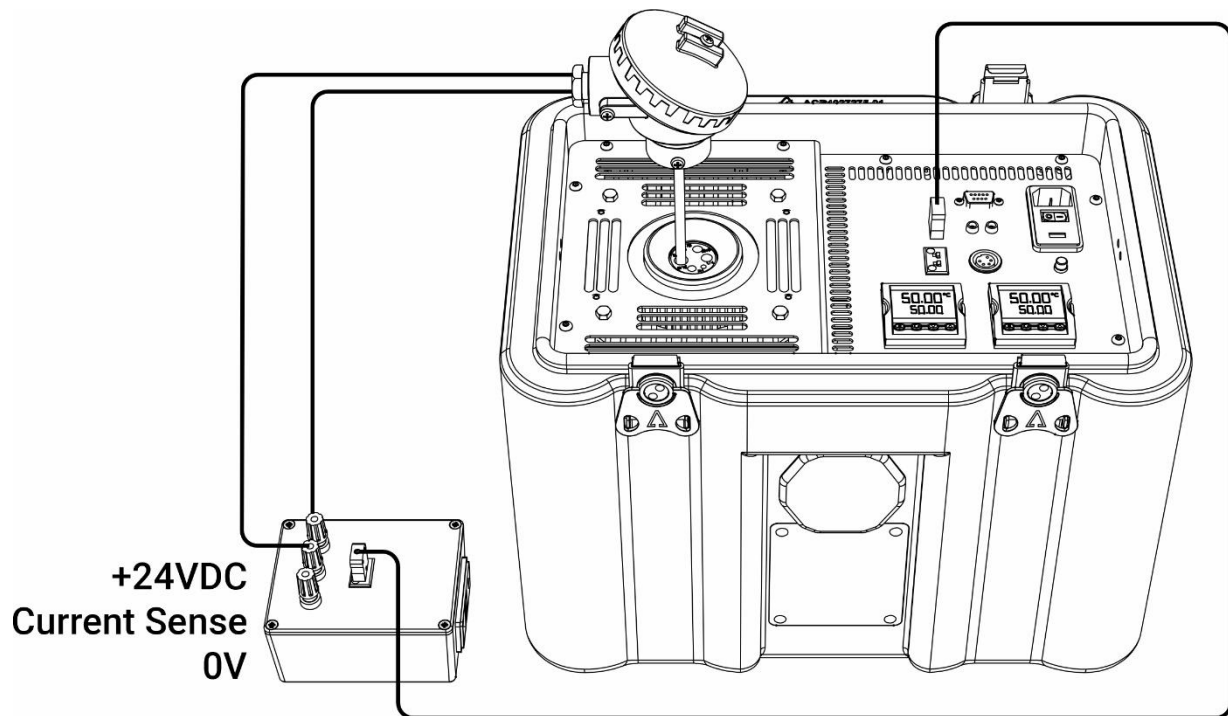

Connect the Transmitter to the equipment as shown in the above image.

**Note:** do not connect 935-06-161 via the PRT socket. The Current Loop interface has built in resistance and does not require the internal resistance of the equipment. Connect via the Thermocouple socket only.


### 21.3 Testing Thermal Switches

The Site Model 787 Rugged dry block calibrators include a switch test facility which is used in conjunction with the supplied Cal Notepad Software. See Cal Note Pad manual or instructions on how to use this.

### 21.4 Procedure for the reversal of the polarity for the Switch Contact feature

1. Enter Configuration level on the temperature Indicator as described in **INDICATOR OPERATION**
2. Press the PAGE button to enter **IO-1**
3. Press the Scroll button to enter **I.SENSE**
4. Use the up/down button to toggle between **nor** or **inv**
5. Exit this level by pressing **PAGE** and **SCROLL** together and selecting either **LEVEL 1** or **LEVEL 2** and the polarity will have changed.


### 21.5 Selecting Input Type

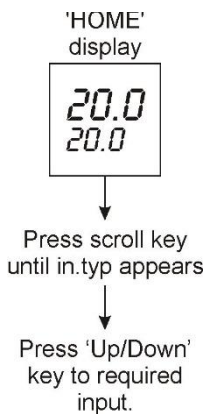

## 22 Using The PC Interface

The 4000 series models include an RS422 PC interface and a special converter cable that allows use with a standard RS232 port. When using the bath with an RS232 port it is essential that this converter cable is used. Replacement cables are available from Isotech, part number ISO-232-432. A further lead is available as an option, Part Number ISO-422-422 lead which permits up to 5 instruments to be daisy chained together.

The benefit of this approach is that a number of calibration baths may be connected together in a "daisy chain" configuration - and then linked to a single RS232, see diagram.

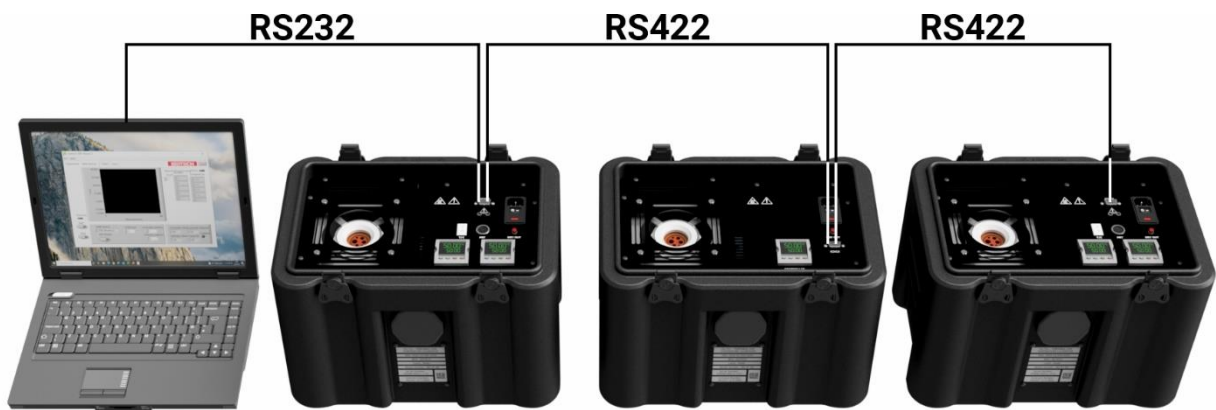

Note: The RS 422 standard specifies a maximum lead length of 1200M (4000ft). A true RS422 port will be required to realise such lead lengths. The Isotech conversion leads are suitable for maximum combined lead lengths of 10M that is adequate for most applications.

### 22.1 Connections

For RS232 use simply connect the Isotech cable.

#### RS422 Connections

Pin	Connection
4	Tx+ A
5	Tx- B
8	Rx+ A
9	Rx- B
1	Common


### 22.2 Protocol

The instruments use the "Modbus Protocol"

If required, e.g. for writing custom software the technical details are available from our Document Library at [www.isotech.co.uk](http://www.isotech.co.uk)

## 23 Cal Notepad

Cal Notepad can be used to log and display values from the Dry Blocks and an optional temperature indicator such as the milliK or TTI-10. The software requires Windows 9X, XP, a minimum of 5Mb of free hard drive space and free serial ports for the instruments to be connected.

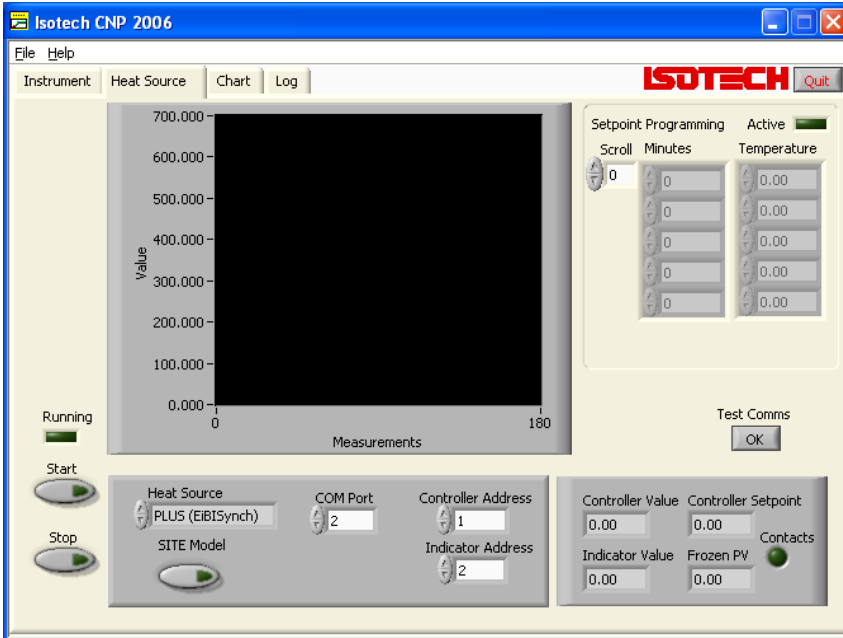


### 23.1 Development

Cal Notepad was developed by Isothermal Technology using LabVIEW from National Instruments. The license details are shown on the download page and in the Cal Notepad manual.

## 23.2 Isotech I-Cal EASY LOG

This application allows logging of data from the 4000 series model. Additionally if a license is purchased it allows for fully automatic calibration including certificate printing and the calculation of coefficients.

Refer to the Isotech I-Cal EASY handbook and help system for more details

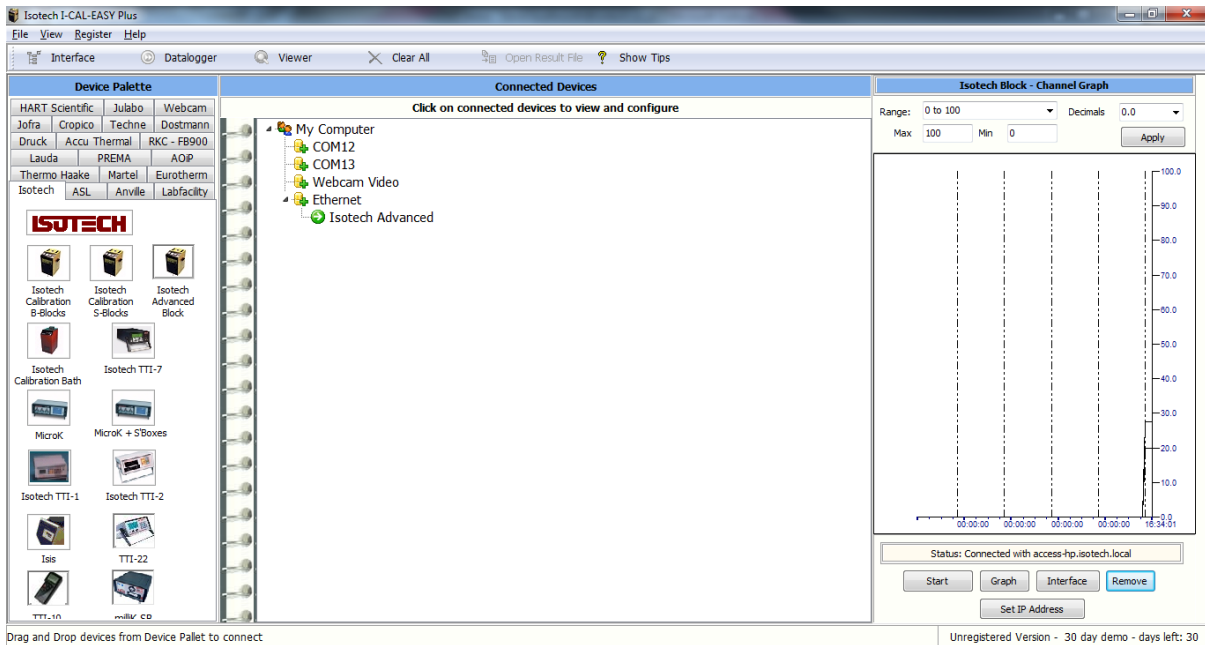

More information can be downloaded from the Isotech website <http://www.isotech.co.uk/downloads>

## 24 Diagnostic Alarms

Diagnostic alarms indicate a possible fault within the controller or connected devices.

Display shows	What it means	What to do about it
E.Conf	<p>A change made to a parameter takes a finite time to be entered. If the power to the controller is turned off before the change has been entered then this alarm will occur.</p> <p>Do not turn the power off to the controller while ConF is flashing</p>	Enter configuration mode then return to the required operating mode. It may be necessary to re-enter the parameter change since it will not have been entered in the previous configuration.
E.CaL	Calibration error	Re-instate Factory calibration, refer to Isotech
E2.Er	EEPROM error	Return to Isotech for repair
EE.Er	Non-vol memory error	Note the error and contact Isotech.
E.Lin	Invalid input type. This refers to custom linearisation which may not have been applied correctly or may have been corrupted.	Go to the INPUT list in configuration level and set a valid thermocouple or input type
Emod	IO1, OP2, or OP3 has been changed	If this has been field changed by the installation of a new board, enter config level, then exit back to operator level. If the message occurs at any other time return to factory for repair.

### Additional Information;

1. If the input is too high HHHHH will be displayed.
2. If the input is too low LLLLL will be displayed.



## **25 Appendix 1: Trouble Shooting**

### **25.1.1 Unit fails to operate**

Check fuse (refer to page 21, item 3). If fuse blows repeatedly consult Isotech or local agent.

### **25.1.2 Will not control at 35°C**

Check room temperature. Minimum operating temperature of 35°C is for a room temperature of 20°C.

### **25.1.3 Indicator reads incorrectly**

Two sensors connected simultaneously.  
Indicator incorrectly configured.

### **25.1.4 Unit unstable**

Control parameters have been interfered with - consult your local agent.

### **25.1.5 Cannot establish PC Communications**

For RS232 you must use the Isotech adaptor cable.  
Ensure the addresses of the controller and indicator match those set in Cal Notepad.  
Ensure each controller and indicator is set to a unique address.  
Refer to 'Using the PC Interface' section and the Cal Notepad manual for further details.

## 26 Appendix 3: Indicator Configuration (Reference Only)

### Config.INST

Name	Description	Value
unit	Instrument Units	`C (0)
dEcP	Decimal Places in Display	NN.NN
Ctrl	Control Type	PID (0)
Act	Control Action	REV (0)
COOL	Cooling Type	LIN (0)
PwrF	Power Feedback Enable	OFF (0)
Pdtr	Manual/Auto Transfer PD Control	NO (0)
FoP	Forced Output Enable	NO (0)
Sbrt	Sensor Break Type	SB.OP (0)
rnGH	Process Value High Limit	670
rnGL	Process Value Low Limit	0.00

### Config.IP

Name	Description	Value
inPt	Linearisation Type	RTD
CJC	CJC Type	(EXT)
imP	Sensor break impedance	AUTO (1)

### Config.CAL

Name	Description	Value
UCAL	User Calibration Enable	YES (1)
Pnt1	User Cal Point 1	0
Pnt5	User Cal Point 5	-99.00
OFS1	User Cal Offset 1	0.00
Pnt2	User Cal Point 2	-99
OFS2	User Cal Offset 2	0.00
Pnt3	User Cal Point 3	-99
OFS3	User Cal Offset 3	0.00
Pnt4	User Cal Point 4	-99.00
OFS4	User Cal Offset 4	0.00
OFS5	User Cal Offset 5	-99.00

Note: User Cal values are unique to each instrument. If available set values to those from calibration certificate

### Config.AL

Name	Description	Value
AL_1	Alarm 1 Type	OFF (0)
Ltch1	Alarm 1 Latching	NO (0)
AL_2	Alarm 2 Type	OFF (0)
Ltch2	Alarm 2 Latching	NO (0)
AL_3	Alarm 3 Type	OFF (0)
Ltch3	Alarm 3 Latching	NO (0)
AL_4	Alarm 4 Type	OFF (0)
Ltch4	Alarm 4 Latching	NO (0)

### Config.HA

Name	Description	Value
id	Module Identity	CMS (7)
Func	Module Function	CMS (65)
bAud	Baud Rate	9600 (0)
Prty	Comms Parity	NONE (0)
rES	Comms Resolution	FUL (0)

### Config.1A

Name	Description	Value
id	Module Identity	LOG (3)
Func	Module function	NONE (0)
SEnS	Sense of Output	NOR (0)

### Config.2A

Name	Description	Value
id	Module Identity	LOG (3)
Func	Module function	NONE (0)
SEnS	Sense of Output	NOR (0)